

PIB # 363

07/10/2017



Product Information Bulletin

BCE3MC Air Handler Intermittent Blower Operation

Allied has received reports of nuisance outdoor unit low-pressure and high-pressure switch trips, no supply airflow and frosted indoor coils due to intermittent operation of the indoor blower. The intermittent blower operation is under investigation and is associated with the blower time delay relay, part number # 104772-01 (19W66) that is currently installed inside the BCE3MC air handler. The units affected are in the range of Serial Number # 1716Gxxxxx and 1717Fxxxxx.

In order to ensure your customer's system operation is not affected, we ask that you change out the current time delay relay with the time delay relay, part number 105241-01 (16D74) at the time of install. The 105241-01 (16D74) time delay relay is a direct replacement for the suspect 104772-01 (19W66) time delay relay. The time delay relays have the same terminal designations, and the wiring is identical. For your convenience, we have provided instructions for you to follow. Changing this relay will prevent the intermittent operation concern.

We apologize for this inconvenience, and we appreciate your cooperation in ensuring the quality of our products.

Contact Allied Technical Support at (800) 515-3501 if you have any questions.

FOR DEALER DISTRIBUTION

